

GAS SPRING POWERLINE

Note:

Initial spring force at 180 bar = 320 daN

Worn gas springs cannot be repaired, they have to be replaced completely.

Pressure medium: Nitrogen N₂

Max. filling pressure: 180 bar

Min. filling pressure: 25 bar

Working temperature: 0°C to +80°C


Temperature related force increase: ± 0.3%/°C

Max. recommended extensions per minute:

approx. 40 to 100 (at 20°C)


Max. piston speed: 1.6 m/s

2487.12.00320.

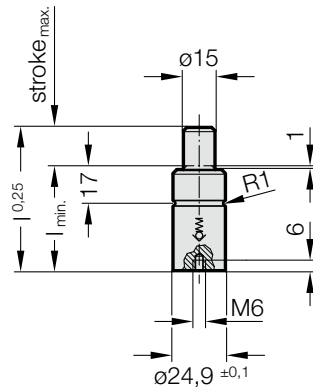

↑ X

View X

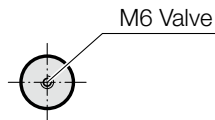


2487.12.00320.


Gas spring POWERLINE

Order No	Stroke _{max.} (s)	l _{min.}	l
2487.12.00320.007	7	37	44
2487.12.00320.010	10	40	50
2487.12.00320.015	15	45	60
2487.12.00320.019	19	49	68
2487.12.00320.025	25	55	80
2487.12.00320.038	38	68	106
2487.12.00320.050	50	80	130
2487.12.00320.063	63	93	156
2487.12.00320.075	75	110	185
2487.12.00320.080	80	115	195
2487.12.00320.100	100	135	235
2487.12.00320.125	125	160	285

Initial spring force versus charge pressure

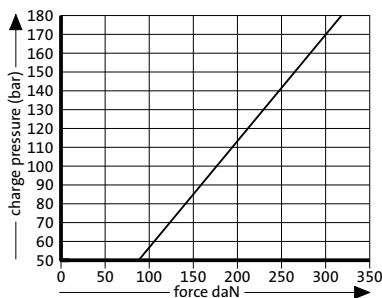

Spring force Diagram displacement versus stroke rise

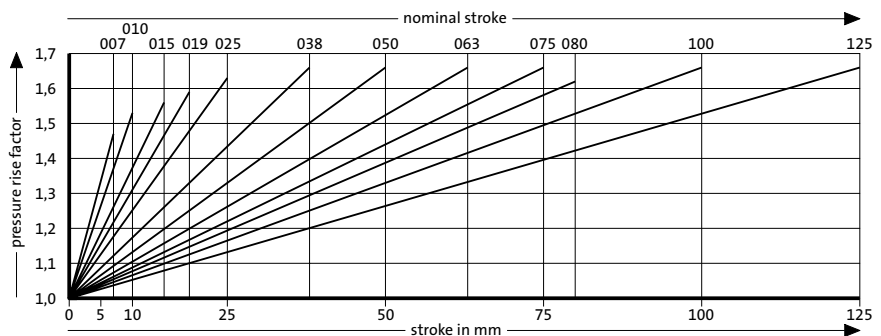

Pressure rise factor accounts for displacement but not external influences!